





Remote Function

Remote Generate



Remote Generate



Smart Key Remote



Garage Remote



OLD-NB-ZONE



Remote Search

Remote Clone



Normal Copy



Special Copy



Remote re-make

Remote Detection



PEUGEOT CITROEN DS

All remotes

B SERIES

PSA CIR57 Peugeot 307
2001-28.03.20052018-05-29
15:32:30

433MHZ

NB Multifunction



408 0536 FSK NB Multifunction

2018-05-29
15:32:26

433MHZ

NB Multifunction



307 0536 ASK NB Multifunction

2018-05-29
15:32:26

433MHZ

NB Multifunction

PSA CIR48 Berlingo (02-08)
(M59)2018-05-29
15:32:30

433MHZ

NB Multifunction



0536 NB Multifunction FSK



Detail



8X0837220D

434MHz

Please select the operating

\$1000

B SERIES



Modulation Mode:

Not Wired generation



Wireless generation



Car alarm system:


Not Simulate device




Advanced settings

Cancel



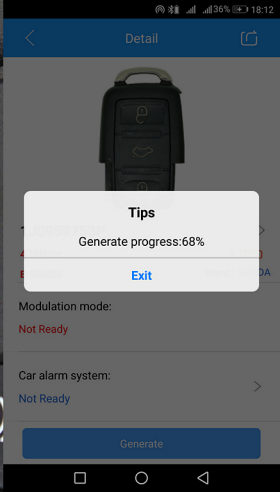

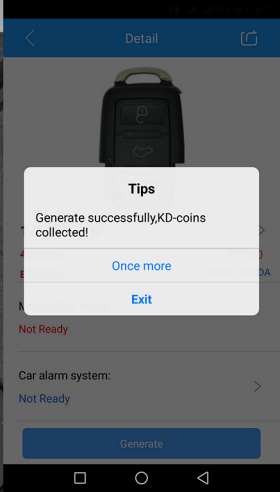



20 KD-Coins

[My Address](#)

Total Number : 1 piece Used:0piece

KD-Coins details

Remote Generated Successfully

+20

2018-06-15 22:45:50

Notice prevent KD-coins loss and get a better after-sale

BMW

5WK49661 F Series868MHZ
Continental

5WK49661 F Series868MHZ Continental
Please connect original remote key with
KD unlock cables to update { Connecting
diagram, coming soon }



Unlock files

Unlock

Unknown codes



Chip Model: **Unknown**

Center Frequency: **434.42 MHz ASK**

Min Pulse Width: 292 us

Data Bits: 656 bits

Data details: 55 55 55 55 55 55 55 55 55

55 55 55 55 55 55 55 55 55

55 55 55 55 55 55 55 55 55

55 55 55 55 55 55 55 55 55

55 55 55 55 55 55 55 55 55

55 55 55 55 55 55 55 55 95

99 55 6A A5 55 55 96 A9 59

9A A9 AA 59 AA 69 59 9A

A9 95 9A 4A 9A 65 66 00 00

00 00





Chip Function

Chip Clone



Automation Detecti...



Access Card



48 Chip Clone



Toyota G Clone



48(96bit) Online



ID48 Query Result

Chip Generation

Toyota G chip
generation

Chip Generation



ID33/40/41/42/44



48 Chip Generation



Automation Detection Clone



Chip copy

Please copy the chip following the prompts

Please put transponder in the induction coil.

Start identifying



Ignition coil detection

Please collect the antenna close to the ignition switch, and hear the prompts or text hints, indicating that the coil signal is normal.





Chip copy

Please copy the chip following the prompts

Please put transponder in the induction coil.

Start identifying



Message Center

After verification can calculate the 96 bit 48 now only support android. Please use KD-coins to have a try . One time calculate need 150 KD-COINS. Generate one KD remote can get 20 coins. Copy one KD 46 chips by multifunctional function remote can get 10 more coins.

2018-06-06 09:33:43

96 bit 48 copy will release in 3 days we need send the code to your telephone so need register in mobile kd and when generate the remote you will get the KD-COINS use KD-COINS you can copy 48. During the test period copy 48 need 150 KD-COINS.

2018-05-31 13:42:58

Login Mobile KD by facebook or twitter and generate the remote can get the Kd-coins. Copy 96 bit 48 need 150 Kd-coins. The 48 copy function will release in 7 days. Some days later we need register the Mobile KD by local mobile phone to use the 48 copy function . Android should be first and then IOS system.

2018-05-30 18:00:30

Hello KDX2 USERS There is some confusion that someone is misguiding you that there are two kinds of KDX2 one with ID48 and one without ID 48. This is false. There is only one kind of KDX2

Order

Official Authorized Dealers



KD Products



KD900+



1



Details



KD900



1



Details



KD200



1



Details

KD Remotes(B series)



B20-3+1



5



Selected species: 0

Pieces:0

Generate orders



Home



Update



Forum



Order



Me

Update

Choose the type you like , and we make for you!

KEYDIY



Online Updates

Remote >

Upgrade History

Recently 50 >

Upgrade KD device

OTG connection >

App Version

v5.0.1 >

Upload the remote information



Home



Update



Forum



Order



Me



System Files Update

Current version: 01.05.02.22

Latest version: 01.05.02.23

Voltage: 3.81V

- 3%

File is being transferred:1/1

The entire update process may take several minutes, please be patient

- 1.During updating, do not operate the phone.
- 2.If update fails, you can also use the PC software to update